Publication No. 1F8761
15JUL03

MODIFICATION INSTRUCTIONS for the *Kodak X-Omat* MULTILOADER 7000 Service Code: 3444

Modification No. 8
Type 1 Selective

Purpose: To upgrade to the Operating Software V_1.24 for the *Kodak X-Omat* MULTILOADER 7000. The Operating Software V_1.24 will prevent the error “CA AB” for the CASSETTE.

To move S1-1 on the MAGAZINE INTERFACE BOARD A4 to the “ON” position if either the MULTILOADER 7000 has failures loading film fully into the CASSETTE or the error log indicates the error “CA 9A”.

Important
Qualified service personnel must install this modification.

Service Effects:	None
Special Requirements:	None
Serial Numbers:	• Upgrading the operating software: 1475 - 1541. Equipment with these serial numbers had the new CASSETTE OPENER SPROCKET KIT installed before shipment to the site. • Moving S1-1 to the “ON” position: 1001 - 1541
Installation Time:	1 hour
Special Tools:	None
Parts Status:	Available from Service Parts Management.
Parts Requirements:	See Page 2.

Confidential
Restricted Information
© Eastman Kodak Company, 2003

PLEASE NOTE The information contained herein is based on the experience and knowledge relating to the subject matter gained by Eastman Kodak Company prior to publication.

No patent license is granted by this information.

Eastman Kodak Company reserves the right to change this information without notice, and makes no warranty, express or implied, with respect to this information. Kodak shall not be liable for any loss or damage, including consequential or special damages, resulting from any use of this information, even if loss or damage is caused by Kodak's negligence or other fault.

This equipment includes parts and assemblies sensitive to damage from electrostatic discharge. Use caution to prevent damage during all service procedures.

MODIFICATION KIT 1F8757 includes:

Part No.	Description	Quantity
1F8573	CD - Operating and Service Software for the *Kodak* MULTILOADERS	1
7C8765	REIMBURSEMENT CARD	1
1F8761	MODIFICATION INSTRUCTIONS	1

Installing the Modification

[1] Download the Operating Software V_1.24 for the *Kodak X-Omat* MULTILOADER 7000 from the CD to the LAPTOP. See the instructions on the CD JEWEL CASE.

[2] Download the Operating Software V_1.24 for the *Kodak X-Omat* MULTILOADER 7000 from the LAPTOP to the MULTILOADER 7000. See the INSTALLATION INSTRUCTIONS 5E9998.

Section	Procedure
Installing the Software	“Downloading the Operating Software from the LAPTOP COMPUTER to the MULTILOADER 7000”

[3] Does the MULTILOADER 7000 load all films fully into the CASSETTE?

Yes	No
Continue with Step 4.	Advance to Step 5.

[4] Does the error log of the MULTILOADER 7000 indicate the error “CA 9A”?

Yes	No
Continue with Step 5.	Advance to “Completing the Modification” on Page 4.

Warning

Dangerous Voltage

[5] De-energize the MULTILOADER 7000.

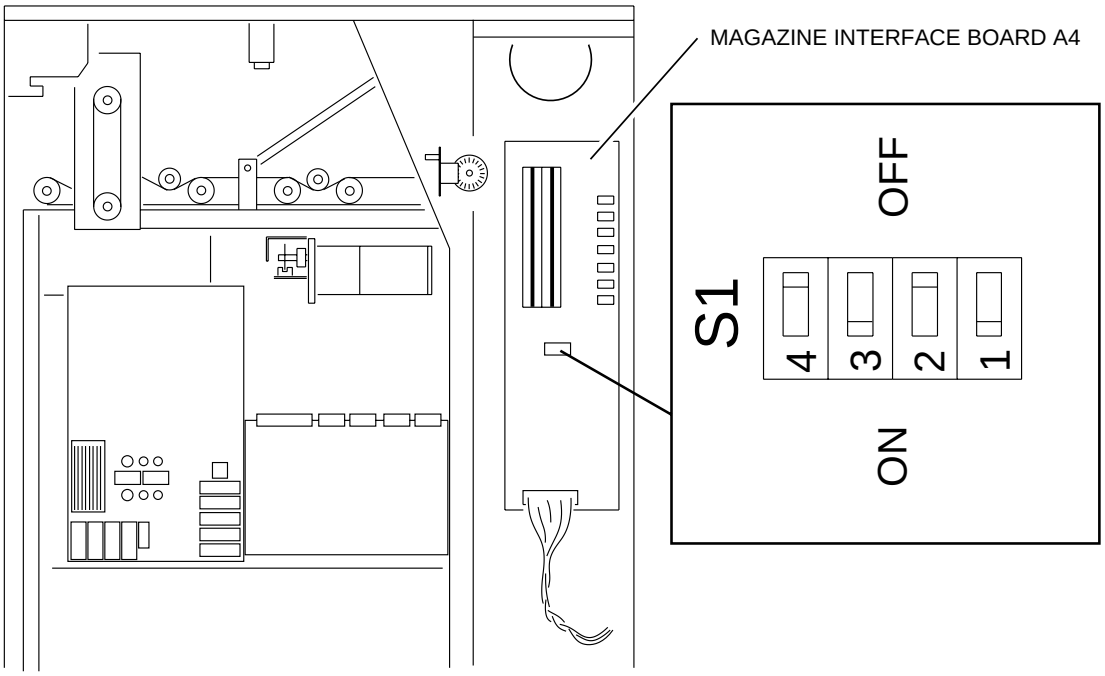

H186_0712HCA
H186_0712HC

[6] On the MAGAZINE INTERFACE BOARD A4, move S1-1 to “ON”.

Note

With the S1-1 in the “ON” position, the “pocket delay” is increased by one second. The “pocket delay” is the time that the MAGAZINE SUCKERBAR waits inside the CASSETTE after the MAGAZINE SUCKERBAR loads the film.

Completing the Modification

Warning

Dangerous Voltage

[1] Energize the MULTILOADER 7000.

[2] Process films to check for correct operation of the MULTILOADER 7000.

[3] Circle “8” on the MODIFICATION LABEL.

[4] Record the information for feedback:

K-number	Service Code	Serial No.	Activity Code	Installation Time	Part No.
	3444		M08		1F8757

Publication History

Publication Date	Publication No.	ECO No.	Changed Pages	File Name	Notes
15JUL03	1F8761	2665-095	---	1f8761.fm	New Publication

Kodak and *X-Omat* are trademarks.

Printed in U.S.A. • 1f8761.fm

EASTMAN KODAK COMPANY
Rochester, NY 14650

HEALTH IMAGING